




# Used Vehicle Inspection Report

Administrator: [REDACTED]	Inspection #	105192
Customer Name: [REDACTED]	Policy / Contract #	[REDACTED]
[REDACTED] houston tx 77008	Facility Phone: [REDACTED]	Facility Contact: [REDACTED]
Reason For Inspection: <b>Pre-purchase inspection -- Test drive the vehicle at least 10 miles. Be sure to take before and after ODOMETER pictures. Call CarInspector.US before you leave. Fax this worksheet ASAP. Upload Photos the evening of the inspection.</b>		
****CALL THE SHOP PRIOR TO GOING TO ENSURE THE VEHICLE IS READY FOR INSPECTION. CALL VERBAL TO CARINSPECTOR.US FROM THE SHOP 888-615-7555 ext 55. UPLOAD PICTURES TO WEBSITE ( <a href="http://www.carinspector.us">http://www.carinspector.us</a> ) THE EVENING OF THE INSPECTION. NO EXCEPTIONS!!!		
Verbal Given To:	NA	Inspected By: HW
Date Inspected:	1-14-11	Time Inspected: 10:30
Yr/Mk/Mdl: 2008 mercedes-benz s550	Mileage before test drive: 41080	after:
VIN: WDDNG71X28A81927	Production Date: 10-07	
Engine Size: 5.5	Fuel Type: GAS	
Transmission Type: AUTO	Drive Type: RWD	
Oil Level: FULL	Oil Condition: SVC DUE	
Coolant Level: FULL	Coolant Condition: GOOD	
Trans Level: NA	Trans Condition: NA	
Front Diff Level: NA	Front Diff Condition: NA	
Rear Diff Level: NA	Rear Diff Condition: NA	
Transfer Case Level: NA	Transfer Case Condition: NA	
Power Steering Level: LOW	Power Steering Condition: GOOD	
Brake Fluid Level: FULL	Brake Fluid Condition: DIRTY	
Belts: GOOD	Hoses: GOOD	Overall Condition: GOOD
	Abuse? NO	Mods? NO
		Overheat? NO
Lack of Lube? NO	Previous or Current Collision? YES	Towing Type? NA
		Tires Factory Size? YES 255-45R18
		Mechanical Failures? NO
		Service History? NO
Service Stickers? YES 1-12-11	Prior Commercial Usage? NO	License Plate Info: NA
		Level of Teardown: FULLY ASSEMBLED
Date: _____ Inspector Signature: _____		

There is existing damage on the vehicle as notated on diagrams to the right. Legend for damage is below:

- B - Bent
- BB - Buffer Burn
- BR - Broken
- C - Cut
- CR - Cracked
- D - Dented
- F - Faded
- FF - Foreign Fluid
- G - Gouged
- L - Loose
- M - Missing
- P - Pitted
- PC - Paint chip
- R - Rubbed
- RU - Rusted
- S - Scratched
- SL - Soiled
- SS - Surface Scratch
- ST - Stained
- T - Torn

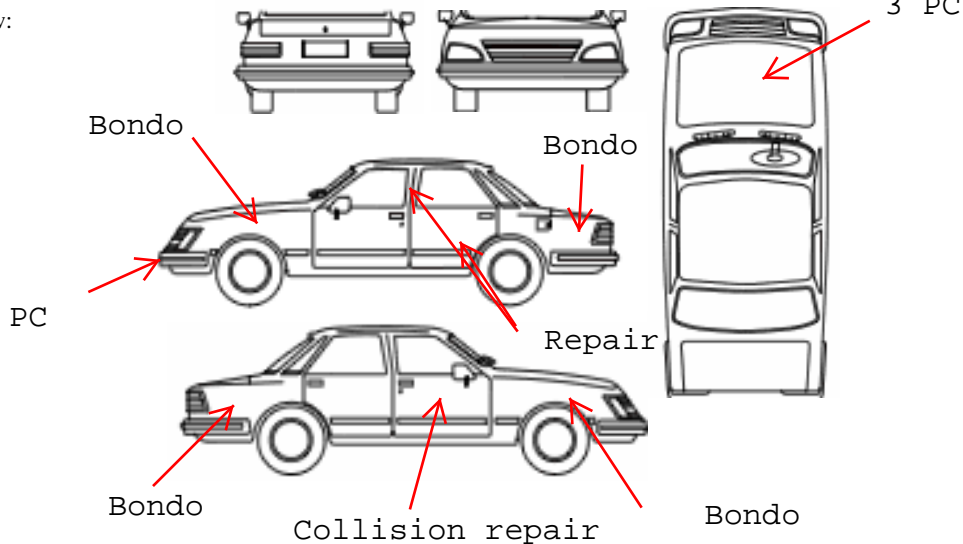

BODY ITEM	OK	DESCRIPTION See legend on pg 1	REPAIR	REPLACE	BODY ITEM	OK	DESCRIPTION See legend on pg 1	REPAIR	REPLACE
Windshield	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>	Tail Lamps	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Hood	<input type="checkbox"/>	3-4 CHIPS	<input type="checkbox"/>	<input type="checkbox"/>	Parking Lamps	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Grille	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>	Interior Lights	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Front Bumper	<input type="checkbox"/>	NICKS	<input type="checkbox"/>	<input type="checkbox"/>	Head Lamps	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Rear Bumper	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>	Carpet	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Right Fender	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>	Upholstery	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Right Front Door	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>	Headliner	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Right Rear Door	<input type="checkbox"/>	COLLISION REPAIR	<input type="checkbox"/>	<input type="checkbox"/>	Dash	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Right 1/4 Panel	<input type="checkbox"/>	COLLISION REPAIR	<input type="checkbox"/>	<input type="checkbox"/>	Front Seats	<input type="checkbox"/>	L/F WORN	<input type="checkbox"/>	<input type="checkbox"/>
Right Rocker Panel	<input type="checkbox"/>	REPLACED?	<input type="checkbox"/>	<input type="checkbox"/>	Rear Seats	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Left Fender	<input type="checkbox"/>	REPLACED?	<input type="checkbox"/>	<input type="checkbox"/>	3 <sup>rd</sup> Seat	<input type="checkbox"/>	NA	<input type="checkbox"/>	<input type="checkbox"/>
Left Front Door	<input type="checkbox"/>	COLLISION REPAIR	<input type="checkbox"/>	<input type="checkbox"/>	Seat Belts	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Left Rear Door	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>	Keyless Entry	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Left 1/4 Panel	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>	Anti-Theft	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Left Rocker Panel	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>	Radio Operation	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Roof	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>	Power Windows	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Deck Lid	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>	Power Locks	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Rear Glass	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>	Power Mirrors	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Frame/Unibody	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>	Horn	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Tires: Front-Left	<input type="checkbox"/>	4	/32	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Front-Right	<input type="checkbox"/>	4	/32	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Rear-Left	<input type="checkbox"/>	6	/32	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Rear-Right	<input type="checkbox"/>	6	/32	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Spare	<input type="checkbox"/>	SPC SVR	/32	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>
Jack/Tire Tools	<input checked="" type="checkbox"/>					<input checked="" type="checkbox"/>		<input type="checkbox"/>	<input type="checkbox"/>

MECHANICAL ITEMS	Good	Fair	Poor	Yes	No	N/A	Comments
<b>Engine:</b>							
Evidence of Leaks				<input type="checkbox"/>	<input checked="" type="checkbox"/>		
Performance	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>				
Abnormal Noises				<input type="checkbox"/>	<input checked="" type="checkbox"/>		
<b>Transmission:</b>							
Performance	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>			<input type="checkbox"/>	
Evidence of Leaks				<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
Abnormal Noises				<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
<b>Steering:</b>							
Performance	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>			<input type="checkbox"/>	
Evidence of Leaks				<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Abnormal Noises				<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
<b>Brakes:</b>							
Performance	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>			<input type="checkbox"/>	
Evidence of Leaks				<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
Abnormal Noises				<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
<b>Air Conditioning</b>							
Performance	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>			<input type="checkbox"/>	
Evidence of Leaks				<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
Abnormal Noises				<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
<b>Drivetrain:</b>							
Performance	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>			<input type="checkbox"/>	
Evidence of Leaks				<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
Abnormal Noises				<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	

All of our inspections are based on a physical description of what is seen and heard through the eyes and ears of our inspectors. We do not advise on the value of the vehicle or authenticate its origin. We do not advise as to purchase or decline any vehicle we inspect. This inspection was performed by CarInspector.US (CIU) in a professional manner, without the use of diagnostic tools or equipment. Accordingly, CIU is not liable for any hidden, latent, or undetected conditions or defects on the vehicle or any of its component parts. This inspection does not create or result in any representations or warranties by CIU with respect to the safety, condition, or operation of the vehicle or any of its parts. CIU expressly disclaims any such representation and warranties. We do not verify if a vehicle is emission compliant. We cannot advise as to how long the vehicle will perform properly. We are not responsible for any problems that can occur after an inspection is completed. CIU guarantees each inspection to be accurate at the time the vehicle is inspected. Physical and mechanical damage can occur between the time a vehicle is inspected and when the vehicle is actually purchased and CIU cannot be held responsible for those occurrences should they ever happen. This inspection does not create or result in any representations or warranties by CIU with respect to safety, condition, or operation of the vehicle or any of its parts. CIU expressly disclaims any such representations and warranties. Any guaranties or warranties implied or not on any vehicle inspected by CIU is strictly with the seller of that vehicle.



Additional Information:

The left and right quarters and fenders have bondo  
Both driver side doors have been replaced.  
There are sand marks in the bondo.  
Mechanically the vehicle was okay.  
The spare tire was not secure.  
There is no frame damage or rust.  
The driver's seat has some wear.  
The trunk latch trim was broken.  
There are stone chips in the hood.





**MFD BY DAIMLERCHRYSLER AG STUTTGART**

	<b>KG</b>	<b>LBS</b>
<b>GWR</b>	<b>2565</b>	<b>5655</b>
<b>GAWR FRONT</b>	<b>1230</b>	<b>2715</b>
<b>GAWR REAR</b>	<b>1335</b>	<b>2940</b>

**PASSENGER CAR MADE IN GERMANY 10/07**  
THIS VEHICLE CONFORMS TO ALL APPLICABLE  
U.S. FEDERAL MOTOR VEHICLE SAFETY, BUMPER  
AND THEFT PREVENTION STANDARDS IN EFFECT  
ON THE DATE OF MANUFACTURE SHOWN ABOVE

**WDDNG71X28A181927**

**C040**



921.1 miles

41080 miles

ph

p

Navi

Audio

Tele



140

931.3 miles

41090 miles

160

mph

Trip

Navi

Audio

Telephone



DAIMLERCHRYSLER AG Mercedes-Benz

# VEHICLE EMISSION CONTROL INFORMATION

Conforms to regulations:

2008 MY

U.S. EPA: T2 BIN 5 LDV

OBD: CA II Fuel: Gasoline

California: ULEV II PC

OBD: CA II Fuel: Gasoline

No adjustments needed.

SFI/AIR/2HO2S(2)/2TWC

Group: 8MBXB05.5U2A

EVAP: 8MBXR0170LNS

Remarks: n/a

A 60 221 45 01

5181962





























